# New Hampshire Volunteer Lake Assessment Program

## 2002 Bi-Annual Report for Hermit Lake Sanbornton



NHDES Water Division Watershed Management Bureau 6 Hazen Drive Concord, NH 03301



## OBSERVATIONS & RECOMMENDATIONS

Welcome back to the New Hampshire Volunteer Lake Assessment Program! As your association continues to participate in VLAP over the years, the database created for your lake/pond will help your association track water quality trends and will ultimately enable the association and DES to identify potential sources of pollutants from the watershed that may affect water quality.

As a rule of thumb, *please* try to sample at least once per month during the summer months (June, July, and August). In addition, it may be necessary to conduct stormwater sampling at multiple locations along a stream using the bracketing technique to pinpoint sources of pollution, and baseline studies could involve bi-weekly or monthly sampling for an extended period of time. DES will let you know if this type of sampling is appropriate.

We understand that future sampling will depend upon volunteer availability, and the associations' water monitoring goals and funding availability. We would like to point out that water quality trend analysis is not feasible with only a few data points. It will take many years to develop a statistically sound set of water quality baseline data. Specifically, after 10 consecutive years of participation in the program, we will be able to analyze the in-lake data with a simple statistical test to determine if there has been a significant change in the annual mean chlorophyll-a concentration, Secchi-disk transparency reading, and phosphorus concentration. Therefore, frequent and consistent sampling will ensure useful data for future analyses.

Please contact the VLAP Coordinator early this spring to schedule our annual lake visit. It would be to your advantage to have our visit early in the summer to refresh your sampling skills!

Finally, please remember that one of your most important responsibilities as a volunteer monitor is to educate your association, community, and town officials to let them know the quality of your lake/pond and what can be done to protect it!

After reviewing data collected from **HERMIT LAKE**, the program coordinators recommend the following actions.

#### FIGURE INTERPRETATION

Figure 1 and Table 1: The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the lake/pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a, and are naturally found in lake ecosystems, the chlorophyll-a concentration found in the water gives an estimation of the concentration of algae or lake productivity. The mean (average) summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 7.02 ug/L.

Similar to the summer of 2001, the summer of 2002 was filled with many warm and sunny days and there was a lower than normal amount of rainfall during the latter-half of the summer. The combination of these factors resulted in relatively warm surface waters throughout the state. The lack of fresh water to the lakes/ponds reduced the rate of flushing which may have resulted in water stagnation. Due to these conditions, many lakes and ponds experienced increased algae growth, including filamentous green algae (the billowy clouds of green algae typically seen floating near shore), and some lakes/ponds experienced nuisance cyanobacteria (blue-green algae) blooms.

The current year data (the top graph) show that the chlorophyll-a concentration *decreased* from June to August.

The historical data (the bottom graph) show that the 2002 chlorophyll-a mean is *less than* the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) **a variable** in-lake chlorophyll-a trend, meaning that the concentration has **fluctuated** since monitoring began in 1990. However, it is important to point out that each chlorophyll concentration has **been less** than the state median. We hope this continues!

After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration since monitoring began.

While algae are naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Therefore, algal concentrations may increase when there is an increase in nonpoint sources of nutrient loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). It is important to continually educate residents about how activities within the watershed can affect phosphorus loading and lake quality.

Figure 2 and Table 3: The graphs in Figure 2 (Appendix A) show historical and current year data for lake/pond transparency. Table 3 lists the maximum, minimum and mean transparency data for each sampling season that the lake/pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.

Two different weather related patterns occurred this past spring and summer that influenced lake quality during the summer season.

In late May and early June of 2002, numerous rainstorms occurred. Stormwater runoff associated with these rainstorms may have increased phosphorus loading, and the amount of soil particles washed into waterbodies throughout the state. Some lakes and ponds experienced lower than typical transparency readings during late May and early June.

However, similar to the 2001 sampling season, the lower than average amount of rainfall and the warmer temperatures during the latter-half of the summer resulted in a few lakes/ponds reporting their best-ever Secchi-disk readings in July and August (a time when we often observe reduced clarity due to increased algal growth)!

The current year data (the top graph) show that the in-lake transparency *increased greatly* from June to August. It is important to note that as the chlorophyll-a concentration decreased from June to August this season, the transparency increased. We

typically expect this inverse relationships in lakes. As the amount of algal cells in the water column decreases, the transparency increases.

The historical data (the bottom graph) show that the 2002 mean transparency is *slightly greater than* state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a decreasing** trend for in-lake transparency, meaning that the transparency has **worsened** since monitoring began. However, please keep in mind that this trend is based on a limited data set.

As discussed previously, after 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to determine long-term trends.

Typically, high intensity rainfall causes erosion of sediments into lakes/ponds and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, lake/pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the lake/pond. Guides to Best Management Practices designed to reduce, and possibly even eliminate, nonpoint source pollutants, such as sediment loading, are available from NHDES upon request.

Figure 3 and Table 8: The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the lake/pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a lake/pond can lead to increases in plant and algal growth over time. The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The current year data for the epilimnion (the top inset graph) and the hypolimnion (bottom inset graph) show that the total phosphorus concentration *decreased* from June to August.

The historical data show that the 2002 mean epilimnetic total phosphorus concentration is **slightly greater than** the state median.

The historical data show that the 2002 mean hypolimnetic total phosphorus concentration is *greater than* the state median.

Overall, visual inspection of the historical data trend line for the epilimnion show **a** slightly increasing total phosphorus trend, which means that the concentration has slightly worsened in the epilimnion since monitoring began.

Overall, visual inspection of the historical data trend line for the hypolimnion shows **a variable** total phosphorus trend, which means that the concentration has **fluctuated** in the hypolimnion since monitoring began.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands. If you would like to educate watershed residents about how they can help to reduce phosphorus loading into the lake/pond, please contact the VLAP Coordinator.

#### TABLE INTERPRETATION

#### > Table 2: Phytoplankton

Table 2 lists the current and historic phytoplankton species observed in the lake/pond. The dominant phytoplankton species observed this year were *Dinobyron* (a golden-brown algae), *Anabaena* (a cyanobacteria), and *Asterionella* (a diatom).

Phytoplankton populations undergo a natural succession during the growing season (Please refer to page 12 of the "Biological Monitoring Parameters" section of this report for a more detailed explanation regarding seasonal plankton succession). Diatoms and golden-brown algae are typical in New Hampshire's less productive lakes and ponds. An overabundance of cyanobacteria (previously referred to as bluegreen algae) indicates that there may be an excessive total phosphorus concentration in the lake/pond, or that the ecology is out of balance. Some species of cyanobacteria, including **Anabaena**, can be toxic to livestock, pets, wildlife, and humans.

Cyanobacteria can reach nuisance levels when excessive nutrients and favorable environmental conditions occur. As with the summer of 2001, we observed that some lakes and ponds had cyanobacteria present during the 2002 summer season, likely due to the many warm and sunny days that occurred this summer, which may have accelerated algal and bacterial growth. In addition, the lower than

normal amount of rainfall during the latter half of the summer, meant that the slow flushing rates resulted in less phosphorus exiting the lake outlet and more phosphorus being available for plankton growth.

The presence of cyanobacteria serves as a reminder of the lake's/pond's delicate balance. Watershed residents should continue to act proactively to reduce nutrient loading into the lake/pond by eliminating fertilizer use on lawns, keeping the lake/pond shoreline natural, re-vegetating cleared areas within the watershed, and properly maintaining septic systems and roads.

In addition, residents should also observe the lake/pond in September and October during the time of fall turnover (lake mixing) to document any algal blooms that may occur. Cyanobacteria (bluegreen algae) have the ability to regulate their depth in the water column by producing or releasing gas from vesicles. However, occasionally lake mixing can affect their buoyancy and cause them to rise to the surface and bloom. Wind and currents tend to "pile" cyanobacteria into scums that accumulate in one section of the lake/pond. If a fall bloom occurs, please contact the VLAP Coordinator.

#### > Table 4: pH

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is 6.5, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding pH, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The mean pH at the deep spot this season ranged from **6.04** in the hypolimnion to **6.62** in the epilimnion, which means that the water is **slightly acidic.** 

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase lake/pond pH.

#### > Table 5: Acid Neutralizing Capacity

Table 5 in Appendix B presents the current year and historic epilimnetic ANC for each year the lake/pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The Acid Neutralizing Capacity (ANC) of the epilimnion (the upper layer) was 5.50 mg/L as CaCO<sub>3</sub> this season Table 5). Specifically, this means that the lake/pond is "moderately vulnerable" to acidic inputs (such as acid precipitation).

#### > Table 6: Conductivity

Table 6 in Appendix B presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

Overall, the conductivity has *increased* in the lake/pond and inlets since monitoring began in 1991 (Table 6). Typically conductivity levels greater than 100 uMhos/cm indicate the influence of human activities on surface water quality. These activities include septic systems that fail and leak leachate into the groundwater (and eventually into the tributaries and the lake/pond), agricultural runoff, and road runoff (which contains road salt during the spring snow melt). New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could contribute to increasing conductivity. In addition, natural sources, such as iron deposits in bedrock, can influence conductivity. It is possible that the lower than normal amount rainfall during the latter-half of the summer reduced tributary and lake flushing, which allowed pollutants and ions to build up and resulted in elevated conductivity levels.

We recommend that your monitoring group conduct stream surveys and stormwater sampling along the inlets with elevated conductivity so that we can determine what may be causing the increases. For a detailed explanation on how to conduct a stream survey and stormwater sampling, please refer to this year's "Special Topic Article" which is included in Appendix D of this report.

#### > Table 8: Total Phosphorus

Table 8 in Appendix B presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae's ability to grow and reproduce. Please refer to page 17 of the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

#### > Table 9 and Table 10: Dissolved Oxygen and Temperature Data

Table 9 in Appendix B shows the dissolved oxygen/temperature profile(s) for the 2002 sampling season. Table 10 shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

The dissolved oxygen concentration was greater than **100%** saturation **5.0** meters at the deep spot on the **June** sampling event. Wave action from wind can also dissolve atmospheric oxygen into the upper layers of the water column. Layers of algae can also raise the dissolved oxygen in the water column, since oxygen is a by-product of photosynthesis. Considering that the depth of the photic zone (depth to which sunlight can penetrate into the water column) was approximately **3** meters on this date (as shown by the Secchi-disk transparency), and that the metalimnion (the layer of rapid decrease in water temperature and increase in density – a place where algae are often found) was located between approximately **4** and **8** meters, we suspect that an abundance of algae caused the oxygen super saturation.

The dissolved oxygen concentration was **low in bottom meter of the hypolimnion** at the deep spot of the lake/pond on the June sampling event. As stratified lakes/ponds age, oxygen becomes **depleted** in the hypolimnion (the lower layer) by the process of decomposition. Specifically, the loss of oxygen in the hypolimnion results primarily from the process of biological breakdown of organic matter (i.e.; biological organisms use oxygen to break down organic matter), both in the water column and particularly at the bottom of the lake/pond where the water meets the sediment.

In addition, during this season, and many past sampling seasons the lake/pond has had a lower dissolved oxygen concentration and a higher total phosphorus concentration in the hypolimnion (the lower layer) than in the epilimnion (the upper layer). These data suggest that the process of *internal total phosphorus loading* (commonly referred to as *internal loading*) is occurring in the lake/pond. When oxygen levels are depleted to less than 1 mg/L in the hypolimnion (as it was this season and in many past seasons), the

phosphorus that is normally bound up with metals in the sediment may be re-released into the water column. Depleted oxygen concentration in the hypolimnion of thermally stratified lakes/ponds typically occurs as the summer progresses.

#### > Table 11: Turbidity

Table 11 in Appendix B lists the current year and historic data for inlake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to page 19 of the "Other Monitoring Parameters" section of this report for a more detailed explanation.

The turbidity of the hypolimnion (lower layer) sample was elevated on the **August** sampling event. This suggests that the lake/pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling. When the lake/pond bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting the hypolimnion sample, please check to make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

#### > Table 12: Bacteria (E.coli)

Table 12 lists the current year data for bacteria (*E.coli*) testing. *E. coli* is a normal bacterium found in the large intestines in humans and other warm-blooded animals. *E.coli* is used as an indicator organism because it is easily cultured, and its presence in the water, in defined amounts, indicates that sewage **MAY** be present. If sewage is present in the water, potentially harmful pathogens may also be present. Please consult page 20 of the "Other Monitoring Parameters section of the report for the current standards for *E. coli* in surface waters. If residents are concerned about sources of *E.coli* such as septic system impacts, animal waste, or waterfowl waste, it is best to conduct *E. coli* testing when the water table is high or after rain events.

The *E. coli* result was **0 counts per 100mL** of sample at the *Hermit Lake Rd Beach* on the June sampling event. We hope this continues!

The *E. coli* result at the **Town Beach** was elevated on the **August** sampling event (**62 counts per 100 mL of sample).** However, the result **was not greater than** the state standard of 88 counts per 100 mL designated for public beaches.

If you are concerned about *E. coli* levels at this beach, you may want to repeat this test on a weekend during heavy beach use or after a rain event. Since bacteria die quickly in cool pond waters, testing is

most accurate and most representative of the health risk to bathers when the source (humans, animals, or waterfowl) is present.

#### DATA QUALITY ASSURANCE AND CONTROL

#### Sample Receipt Checklist:

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if the volunteer monitors followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, future reoccurrences of improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did an *excellent* job when collecting samples and submitting them to the laboratory this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the laboratory staff to contact your group with questions, and no samples were rejected for analysis.

#### **OTHER COMMENTS**

➤ During the fall of 2002, the volunteer monitor contacted the VLAP Coordinator about the use of calcium chloride on nearby gravel roadways as a dust control agent. The Limnology Center Director has suggested that the volunteer monitors take conductivity and chloride samples in the streams near the gravel roads next spring. Please contact the VLAP Coordinator at 271-2658 for instructions.

#### Notes

**Biologist's Note (6/18/02):** North Inlet and Beaver Pond Inlet not sampled. Marie will try to sample these inlets on the next sampling event using a kayak.

**Monitor's Note (8/21/02):** All inlets dried up so no inlet samples taken.

#### **USEFUL RESOURCES**

Changes to the Comprehensive Shoreland Protection Act: 2001 Legislative Session, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/sp/sp-8.htm

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/wmb/wmb-10.htm

The Lake Pocket Book. Prepared by The Terrene Institute, 2000. (internet: www.terrene.org, phone 800-726-4853)

Managing Lakes and Reservoirs, Third Edition, 2001. Prepared by the North American Lake Management Society (NALMS) and the Terrene Institute in cooperation with the U.S. Environmental Protection Agency. Copies are available from NALMS (internet: <a href="www.nalms.org">www.nalms.org</a>, phone 608-233-2836), and the Terrene Institute (internet: <a href="www.terrene.org">www.terrene.org</a>, phone 800-726-4853)

Organizing Lake Users: A Practical Guide. Written by Gretchen Flock, Judith Taggart, and Harvey Olem. Copies are available form the Terrene Institute (internet: <a href="www.terrene.org">www.terrene.org</a>, phone 800-726-4853)

Proper Lawn Care in the Protected Shoreland: The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or <a href="https://www.des.state.nh.us/factsheets/bb/bb-15.htm">www.des.state.nh.us/factsheets/bb/bb-15.htm</a>

Swimmers Itch, WD-BB-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-2.htm

Use of Lakes or Streams for Domestic Water Supply, WD-WSEB-1-11, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/ws/ws-1-11.htm


Water Milfoil, WD-BB-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-1.htm


Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm

## Appendix A: Graphs


## Hermit Lake, Sanbornton


Figure 1. Monthly and Historical Chlorophyll-a Results

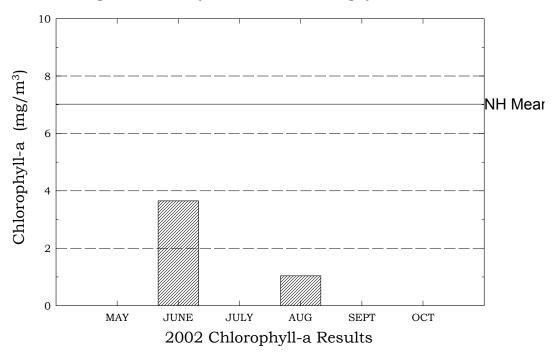

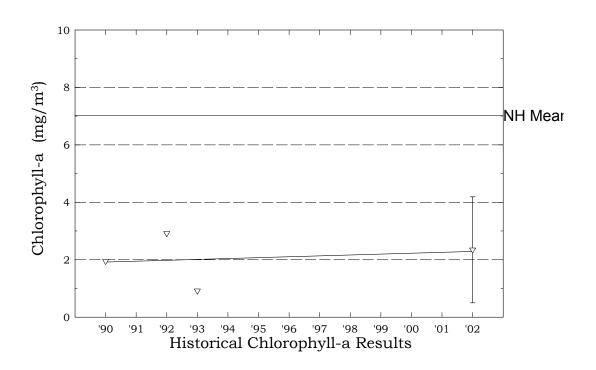

### Hermit Lake, Sanbornton

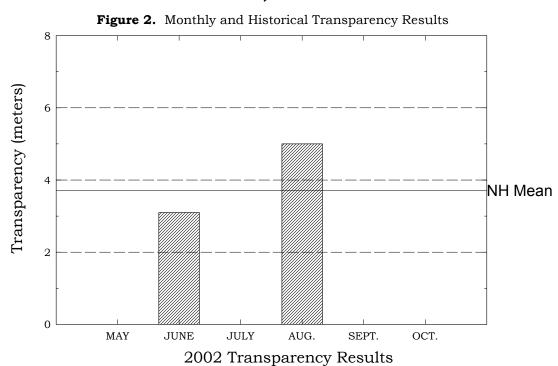

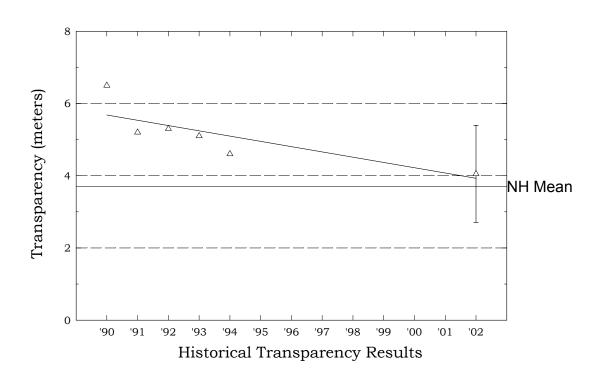

### Hermit Lake, Sanbornton

